


# EI FERRITE CORES

UNIT (mm)

## SHAPES AND DIMENSIONS

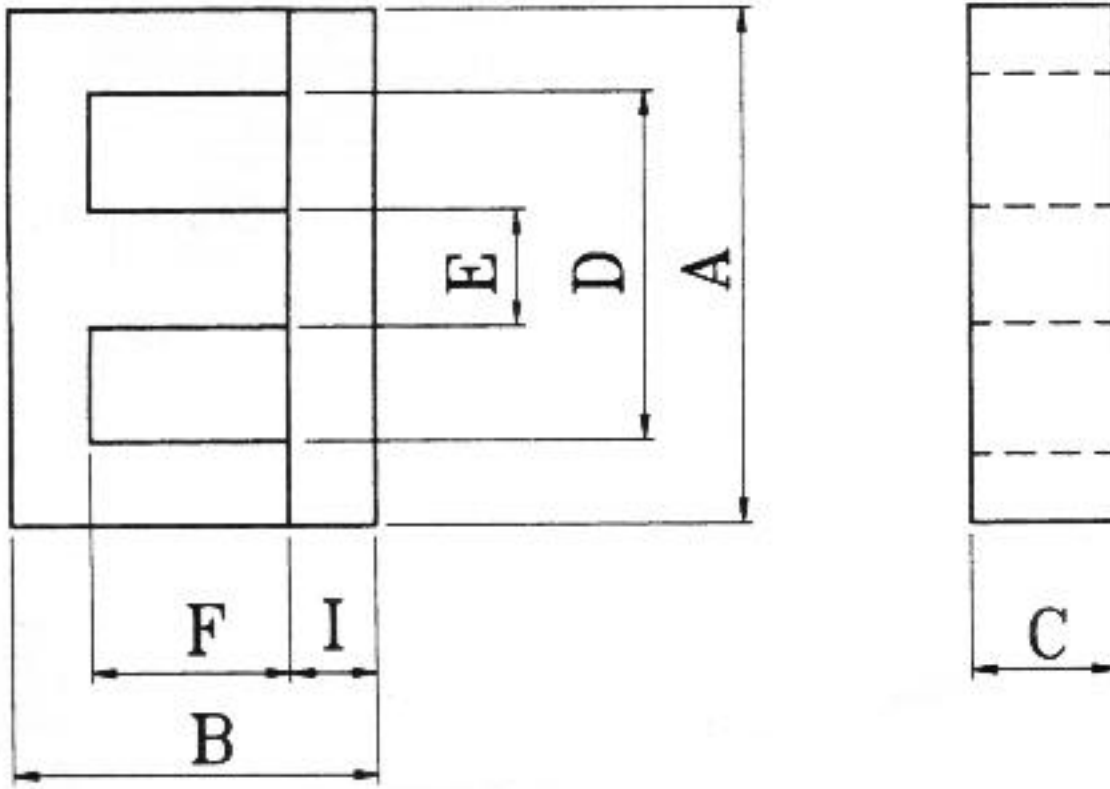

## DIMENSIONS OF MAIN PRODUCTION

Item	A	B	C	D	E	F	I
EI-8.3	8.3±0.3	8±0.2	3.5±0.2	6 <sup>+0.3</sup> <sub>-0</sub>	2 <sup>+0</sup> <sub>-0.3</sub>	6±0.2	1±0.15
EI-10	10±0.3	11±0.3	4.9 <sup>+0</sup> <sub>-0.3</sub>	7.7 <sup>+0.3</sup> <sub>-0</sub>	2.4±0.2	8.3±0.3	1.3±0.15
EI-10X3	10±0.3	10.2±0.3	3 <sup>+0</sup> <sub>-0.3</sub>	7.1±0.3	3±0.2	7±0.3	1.6±0.15
EI-12.5	12.5±0.3	9.1±0.35	5±0.2	9.2 <sup>+0.25</sup> <sub>-0.15</sub>	2.5 <sup>+0.1</sup> <sub>-0.2</sub>	5±0.15	1.6±0.15
EI-12.5A	12.5±0.3	10±0.35	5±0.2	9.2 <sup>+0.25</sup> <sub>-0.15</sub>	2.5 <sup>+0.1</sup> <sub>-0.2</sub>	5±0.15	2.5±0.15
EI-12.6	12.6±0.3	8±0.2	6±0.3	10.1±0.3	3.18±0.15	5.8±0.2	1.1±0.15
EI-13	13±0.3	12±0.4	6.3 <sup>+0</sup> <sub>-0.4</sub>	10.5±0.3	2.95 <sup>+0</sup> <sub>-0.4</sub>	9.2±0.3	1.5±0.15
EI-16	16.25±0.35	14.5±0.4	5.1 <sup>+0</sup> <sub>-0.4</sub>	12.4±0.3	4±0.2	10.3 <sup>+0.4</sup> <sub>-0</sub>	2.05±0.2
EI-19	19.2 <sup>+0.5</sup> <sub>-0.3</sub>	15.9±0.4	5.1 <sup>+0</sup> <sub>-0.5</sub>	14.5±0.3	5.1 <sup>+0</sup> <sub>-0.5</sub>	11.3±0.3	2.35±0.2
EI-20	20.3±0.4	16.8±0.4	4.8±0.2	15.7±0.4	4.8±0.2	12.4±0.4	2.2±0.2

# EI FERRITE CORES

UNIT (mm)

EI-22	22±0.4	19.2±0.6	6 $\begin{smallmatrix} +0 \\ -0.5 \end{smallmatrix}$	16.5±0.3	6 $\begin{smallmatrix} +0 \\ -0.5 \end{smallmatrix}$	11±0.4	4±0.2
EI-22A	22±0.4	19.2±0.6	5.9±0.25	15.6±0.3	6 $\begin{smallmatrix} +0 \\ -0.5 \end{smallmatrix}$	11±0.4	4±0.2
EI-25	25±0.4	20±0.4	6.5±0.3	18.8±0.3	6.5±0.3	13.6±0.3	3.2±0.2
EI-25.4	25.4±0.5	19.5±0.4	6.35±0.3	19.5±0.5	6.25±0.25	13.2±0.3	3.2±0.2
EI-28	28±0.5	21.5±0.5	11 $\begin{smallmatrix} +0 \\ -0.5 \end{smallmatrix}$	19.1±0.3	7.2±0.3	12.5±0.3	4.5±0.3
EI-30A	30 $\begin{smallmatrix} +0.6 \\ -0.3 \end{smallmatrix}$	26.5 $\begin{smallmatrix} +0.8 \\ -0.2 \end{smallmatrix}$	11 $\begin{smallmatrix} +0 \\ -0.7 \end{smallmatrix}$	20 $\begin{smallmatrix} +0.7 \\ -0 \end{smallmatrix}$	11 $\begin{smallmatrix} +0 \\ -0.7 \end{smallmatrix}$	16 $\begin{smallmatrix} +0.6 \\ -0 \end{smallmatrix}$	5.5±0.2
EI-33	33±0.5	28.6±0.5	13 $\begin{smallmatrix} +0 \\ -0.5 \end{smallmatrix}$	24±0.5	10 $\begin{smallmatrix} +0 \\ -0.5 \end{smallmatrix}$	19.2±0.3	5.2±0.2
EI-35	35±0.5	29.7±0.5	12 $\begin{smallmatrix} +0 \\ -0.5 \end{smallmatrix}$	25.5±0.5	10.3 $\begin{smallmatrix} +0 \\ -0.5 \end{smallmatrix}$	18.2±0.3	5.5±0.2
EI-40	40±0.6	34.7±0.6	12 $\begin{smallmatrix} +0 \\ -0.7 \end{smallmatrix}$	27.5±0.5	11.7±0.3	20.6±0.3	7.2±0.3

ITEM	ALnH±25%							
	JP40	J2M	J2	J3	J4	J5	J6	J7
EI-10			1000					
EI-12.5	1200		1300	1500	1700			
EI-13			1250					
EI-16	1150	1150	1300	1500	1700			
EI-19	1300	1300	1500	1750	2000			
EI-22	2000		2100	2500				
EI-25.4	2000	2000	2300	2500	3000			
EI-28	4000		4800	5500				
EI-30A			5000	5800				
EI-33			5000					
EI-35X10			4100					
EI-35X12			4800	5500				
EI-40			5000					