


EE Core (Iron Powder)

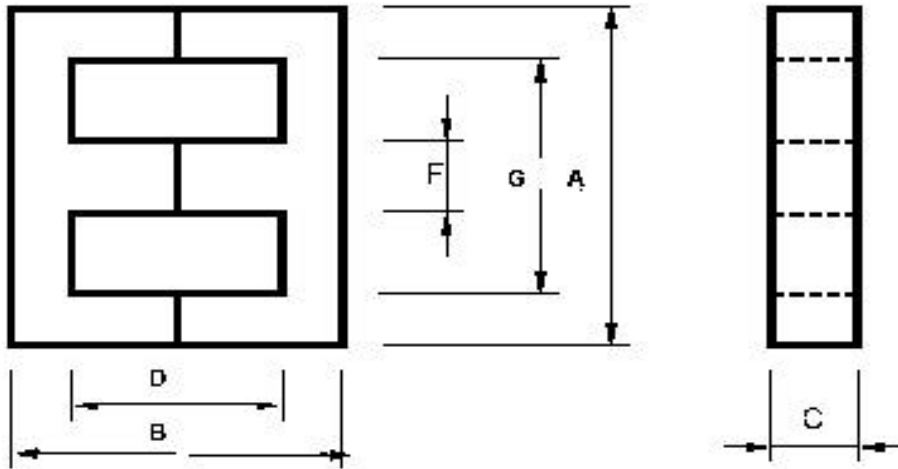

Curie Part Number	Dimensions						Material / AL VALUE nH/N ²				
	A mm	B mm	C mm	D mm	F mm	G mm	SF53	75	75H	90	35
E75-xx	19.1	16.1	4.75	11.6	4.75	14.3	43.3	64	59	70.8	33.5
E100-xx	25.4	19.2	6.35	12.7	6.35	19.1	65	92	85	107	48
E118-xx	30.1	30.1	7.06	19.9	7.06	19.9	66	90	90	108	42
E137-xx	34.9	29.1	9.53	19.6	9.53	25.4	100	134	131	157.2	67
E162-xx	41.3	34.1	12.7	21.4	12.7	28.6	149	210	199	238.8	105
E168-xx	42.8	42.2	15.0	30.7	12.0	30.7	135	195	179	214.8	97
E168A-xx	42.8	42.2	20.0	30.7	12.0	30.7	170	232	230	276	116
E187-xx	47.4	39.4	15.7	24.2	15.7	31.8	213	265	265	318	144
E220-xx	56.1	55.4	20.8	38.8	17.3	38.6	196	275	262	314.4	143
E225-xx	56.9	47.6	18.9	29.0	18.9	38.1	240	325	325	390	173